

150 Clayton Commerce Center
Clayton, North Carolina 27520
919-553-2995 (Voice) 919-553-0437 (Fax)

SERVICE BULLETIN 001
FOR SYSTEM 3000D EAS

January 2, 1997

Scope: Service Bulletin Number 001 covers the following:

- (1) An incorrect factory setting of a jumper on the Sound Card.
- (2) Makes notice of Software Fix Disk 1
- (3) Makes V1.0 manual addendum in the operation section concerning event codes not to be forwarded.
- (4) Makes V1.0 manual addendum concerning remote control function for /Send RWT

Item 1:

- (A). Remove the top cover from the System 3000D.
- (B). Locate the sound card assembly. The sound card assembly is the third card from the left (plugged into the motherboard assembly).
- (C). Remove the sound card.
- (D). Locate and remove the jumper labeled DBS1. DBS1 is the third jumper from the bottom in the jumper column closest to the bottom of the board.
- (E). Reinstall card and top cover.

Item 2:

- (A). Software FIX DISK 1 is now available. FIX DISK 1 adds the file ORG.DAT to the root directory. FIX DISK 1 is being mailed Jan 2, 1997, and will be available from WWW.MTS-COMM.COM

Item 3: Manual Update

- (A). The following is added to Section 4, Operation (page 19) Change Delay Menu: Setting the Delay time to 000 Seconds, instructs the System 3000D to make a log entry for the received EAS event and disables message forwarding for that event. Setting the Delay time to 999 Seconds, instructs the System 3000D to hold the message for manual forwarding.

Item 4: /Send RWT is not enabled in V1.0.